

Release Notes for DrayTek Vigor2830 series (UK/Ireland)

Dual band for wireless models

Firmware Version	3.8.8.3 db
Release Type	Regular – Upgrade recommended when convenient Note: A previous firmware (3.7.2) was a critical release . This f/w includes all changes/improvements that were in 3.7.2.
Release Date	17 th August 2018
Build Date	31 st July 2018
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
Revision	75523
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

New Features

(None)

Improvements

1. Improved compatibility with ISPs providing PPP based IPv6 internet connectivity

Known Issues

1. Before upgrading firmware, take a configuration backup. After upgrade to 3.8.8.3 it is not possible to revert and downgrade to a firmware version prior to 3.6.8.6 without resetting the unit. To downgrade from 3.8.8.3 firmware, reflash earlier firmware using .rst firmware and reload the configuration backup from the previous firmware version
-

Firmware File Types

The ZIP file contains the firmware with two different file extensions, .ALL and .RST. The firmware is identical but the RST file contains factory default settings. If you install the ALL file, your router will retain all existing settings. If you use the RST file, all settings will be wiped from your router.

IMPORTANT NOTE - Wireless

If your Vigor 2830 unit is a wireless model then this firmware is only suitable for DUAL-BAND models. All 'plus' units are Dual-Band. Most non-Plus units sold from approximately August 2011 onward are single band. Non-Plus units sold before August 2011 may be single or dual-band.

If you're not sure which you have, check this guide:

<http://www.draytek.co.uk/support/guides/kb-vigor-2830-dual-band>

IMPORTANT NOTE – Hardware Versions

This firmware is for use with the Vigor 2830 version 1 hardware, not the 'v2' (version 2) unit. Check this guide to confirm which hardware version you have:

<https://www.draytek.co.uk/support/guides/kb-v2830n-v1-vs-v2>

NOTE: ADSL Modem Codes

- For general purpose usage on UK lines, modem code 232201 is recommended.
- For ADSL2+ Annex M lines, the latest modem code 2471201 is suggested.
- For line speeds of less than 4Mbps, on lower quality lines a modem code with more conservative parameters, 211801 is suggested

Upgrade Instructions

It is recommended that you take a configuration backup prior to upgrading the firmware. This can be done from the router's system maintenance menu.

To upgrade firmware, select '*firmware upgrade*' from the router's system maintenance menu and select the correct file. Ensure that you select the ALL file unless you want to wipe out your router's settings back to factory default.



Manual Upgrade

If you cannot access the router's menu, you can put the router into 'TFTP' mode by holding the RESET whilst turning the unit on and then use the Firmware Utility. That will enable TFTP mode. TFTP mode is indicated by all LEDs flashing. This mode will also be automatically enabled by the router if there is a firmware/settings abnormality. Upgrading from the web interface is easier and recommended – this manual mode is only needed if the web interface is inaccessible.

Firmware Version	3.8.8.2 db
Release Type	Critical – Upgrade recommended immediately
Release Date	22 th May 2018
Build Date	21 st May 2018
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
Revision	73978
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

Security Advisory

1. Check your DNS and DHCP settings on your router.

<https://www.draytek.co.uk/support/security-advisories/kb-advisory-csrf-and-dns-dhcp-web-attacks>

If you have a router supporting multiple LAN subnets, check settings for each subnet. Your DNS settings should be either blank, set to the correct DNS server addresses from your ISP or DNS server addresses of a server which you have deliberately set (e.g. Google 8.8.8.8). A known rogue DNS server is 38.134.121.95 - if you see that, your router has been changed.

New Features

None

Improvements

1. This firmware includes improvements to harden the web interface against attacks. We have become aware of specific attacks against router, including DrayTek models where hackers have altered specific settings relating to your DNS servers and DHCP settings. You should urgently check those settings on your router. If they appear to have been tampered with, correct them and change your admin password and for any other config anomalies. Restore a config backup if you have one (from prior to the attack). We continue to investigate this issue but the first priority was to issue updated firmware.

Known Issues

1. Before upgrading firmware, take a configuration backup. After upgrade to 3.8.8.2 it is not possible to revert and downgrade to a firmware version prior to 3.6.8.6 without resetting the unit. To downgrade from 3.8.8.2 firmware, reflash earlier firmware using .rst firmware and reload the configuration backup from the previous firmware version

Firmware Version	3.7.0 db
Release Type	Regular – Upgrade recommended when convenient
Release Date	28 th February 2018
Build Date	8 th February 2018
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
Revision	71466
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

New Features

1. Support for additional TR-069 parameters to configure [System Maintenance] > [Management] settings through VigorACS

Improvements

(None)

Known Issues

1. Before upgrading firmware, take a configuration backup. After upgrade to 3.7.0 it is not possible to revert and downgrade to a firmware version prior to 3.6.8.6 without resetting the unit. To downgrade from 3.7.0 firmware, reflash earlier firmware using .rst firmware and reload the configuration backup from the previous firmware version

Firmware Version	3.6.9 db
Release Type	Regular – Upgrade recommended when convenient
Release Date	3 rd January 2018
Build Date	7 th December 2017
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
Revision	70391
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

New Features

1. EAPOL Key Retry Enable/Disable setting added to [Wireless LAN] > [Security] Disabling this setting can prevent WPA2 Key Reinstallation Attack (KRACK) attack vectors, for more details please read this security advisory:
<https://www.draytek.co.uk/information/our-technology/wpa2-krack-vulnerability>
(EAPOL Key Retry is set to Enabled by default and in previous firmware)

Improvements

1. TR-069 (TCP & UDP 8069) Internet access control now controlled by Access List
2. Improved LDAP server interoperability when authenticating L2TP with IPsec connections
3. Improved display of VoIP Status information with Firefox browser

Known Issues

2. Before upgrading firmware, take a configuration backup. After upgrade to 3.6.9 it is not possible to revert and downgrade to a firmware version prior to 3.6.8.6 without resetting the unit. To downgrade from 3.6.9 firmware, reflash earlier firmware using .rst firmware and reload the configuration backup from the previous firmware version

Firmware Version	3.6.8.7 db
Release Type	Regular – Upgrade recommended when convenient Note: A previous firmware (3.6.8.6) was a critical release . This f/w includes all changes/improvements that were in 3.6.8.6.
Release Date	21 st September 2017
Build Date	10 th August 2017
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
Revision	67375
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

New Features

1. Support for extra TR-069 parameters

Improvements

(None)

Known Issues

1. Before upgrading firmware, take a configuration backup. After upgrade to 3.6.8.7 it is not possible to revert and downgrade to a firmware version prior to 3.6.8.6 without resetting the unit. To downgrade from 3.6.8.7 firmware, reflash earlier firmware using .rst firmware and reload the configuration backup from the previous firmware version

Firmware Version	3.6.8.6 db
Release Type	Critical – Upgrade recommended immediately
Release Date	20 th December 2016
Build Date	6 th December 2016
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

New Features in this Firmware

(None)

Improvements in this firmware

1. Security improvements including one or more considered critical.
2. Misc. minor WUI changes/corrections.
3. Resolved an issue with PPTP VPN Passthrough for NAT to some types of internal PPTP VPN server

Known Issues

1. Before upgrading firmware, take a configuration backup. After upgrade to 3.6.8.6 it is not possible to revert and downgrade without resetting the unit. To downgrade from 3.6.8.6 firmware, reflash earlier firmware using .rst firmware and reload the configuration backup from the previous firmware version

Firmware Version	3.6.8.5 db
Release Type	Regular – Upgrade recommended when convenient
Release Date	1st November 2016
Build Date	22nd August 2016
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

New Features

1. Router auto-generates unique Self-Signed Certificate for HTTPS upon firmware upgrade
2. Added options in [System Maintenance] > [Management] to disable HTTPS management via TLS 1.0, TLS 1.1 or TLS 1.2

Improvement

1. Session validation method improved in Web UI

Known Issues

1. Before upgrading firmware, take a configuration backup. After upgrade to 3.6.8.5 it is not possible to revert and downgrade without resetting the unit. To downgrade from 3.6.8.5 firmware, reflash earlier firmware using .rst firmware and reload the configuration backup from the previous firmware version
2. PPTP VPN Passthrough for NAT to some types of internal PPTP VPN server may prevent a VPN establishing successfully

Firmware Version	3.6.8.4 db
Release Date	5th February 2016
Build Date	15th January 2016
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

New Features

1. Web Server and SSL VPN supports TLS 1.2

Improvement

1. Improved TCP SYN protection mechanism
2. Support for TR-069 HTTP/HTTPS trigger, available in [System Maintenance] > [TR-069]
"Test with Inform" button

Known Issues

(None)

Firmware Version	3.6.8.2 db
Release Date	21st May 2015
Build Date	11th May 2015
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

New Features

(None)

Improvement

1. [System Maintenance] > [TR-069] now has a Wizard button to enter the address of the ACS server with the required URL.
2. DHCP Option 66 now supports special characters such as \$ (through CLI, using "srv dhcp option" command).
3. An issue that caused problems with LAN DNS and DNS Caching has been resolved.
4. Support for the MF825A USB modem.
5. Resolved a DHCP issue with [WAN] > [Multi-VLAN] - Port Based Bridge mode
6. Access List for router management was not working correctly when using a LAN to LAN VPN as the default route.
7. Resolved an issue with the Firewall that could stop users accessing the internet due to a session limit error under some circumstances.
8. User management was not working correctly when using User-Based mode.

Firmware Version	3.6.8 db
Release Date	21th February 2015
Build Date	20th January 2015
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
ADSL Modem Code	211801
Locale	UK Only / Annex A Only

New Features

(None)

Improvement

1. SSL3 now disabled in favour of TLS by default for SSL tunnels and web management.
2. Added TR-069 parameters to configure SNMP management.
3. Support for RFC3021 (Using a /31 Subnet Mask WAN interface).
4. Corrected issue that may have prevented fail over to a 3G Backup interface after 36 days of uptime.
5. SIP phones connected to the router's LAN could experience issues with registration under specific circumstances.
6. Added telnet command to disable/enable LAN ports - "port enable/disable x".
7. Added TR-069 parameter to disable/enable LAN ports.

Firmware Version	3.6.7.1 db
Release Date	6th August 2014
Build Date	24th June 2014
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
ADSL Modem Code	211801
Locale	UK Only / Annex A Only

New Features

1. User Defined Daylight Saving
2. DNS Cache Table

Improvement

1. Updated SSL for CVE-2014-0224
2. Resolved issue of firewall blocking IPv6 incoming routing traffic.

Firmware Version	3.6.7 db
Release Date	17 th June 2014
Build Date	24 th March 2014
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

New Features

(None)

Improvement

1. Additional USB modem support inc. Support Huawei E303D, Vodafone K4201, SpinCom GPRS Modem, vodafone K3772-Z, Infinity IW-021, Option iCON XY modems
2. Improved: Support NS/ANY/SOA type for DNS cache.
3. IPv6 firewall packet processing improvements
4. Additional option to firewall to control incoming non-nat packets for IPv6 and IPv4
5. Add some TR-069 parameters for setting WAN >> WAN mode: Backup or Always On, LAN >> DHCP relay enable/disable, DHCP relay IP address and Device hostname, LAN >> Bind IP to MAC, VPN >> Create Phase2 SA for each subnet.(IPSec), VPN >> Netbios Naming Packets Pass/Block, Firewall >> IPv6 Group/IPv6 Object, SNMP, and Diagnostics >> Ping Diagnosis.
6. Support to block Tor tunnel ver. 0.2.3.25, hotspot shield with ver.3.19, and telnet protocol by using "putty" or "pietty" for APP Enforcement.
7. Support block page for DNS filter.
8. Add SSL VPN setting in VPN Server Wizard.
9. Add Wizards menu.
10. Route policy supports VPN LAN to LAN traffics.
11. In URL RedirectIn LAN>>Web Portal Setup add option to require user to click button to proceed
12. Add VLAN tag for WAN IPv6 packets if WAN VLAN tag is enabled.
13. Resolved some DHCP relay issues
14. Correct SSH memory handling.
15. Load Balance/Route Policy didn't work with WAN5 in PPP mode.
16. Load Balance/Route Policy clean all sessions when the dropped down WAN reconnected.
17. DDNS could not work when updating to freedns.afraid.org
18. Could not add DHPC option 66/15.
19. Router showed wrong Syslog messages when a VPN LAN to LAN tunnel drops.
20. Router dropped all DNS packets with unknown type.
21. SSH didn't work with Mac OS, while it did with Windows and Linux.
22. VigorACS SI couldn't show Network information when DNS Filter was enabled for Vigor2830.
23. External Device Status page improved

24. Removed Mhaha, getMessenger, IMUnitive, Wablet from WebIM on CSM>>APP Enforcement Profile.

1. If the firmware of the router is upgraded from 3.6.6(or before) to 3.6.7 firmware, .all and .rst will have different effects for the incoming packets.
 - 1) .all --> allow routing settings in 3.6.6(or before), (both IPv4 and IPv6)
 - 2) .rst --> block routing packets from WAN in default, (both IPv4 and IPv6)

Firmware Version	3.6.4 db
Release Date	7th May 2013
Build Date	19th March 2013
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
ADSL Modem Code	232201 (Standard)
Locale	UK Only / Annex A Only

New Features

1. SSL VPN support up to 5 dial-in users
2. Added Web Portal (displays message on connection) in [LAN] – [Web Portal Setup]
3. Added Wireless Configuration Wizard.
4. IPv6 USB LPR printing service.
5. Mail Alert now supports sending mail via SSL / TLS and can specify the SMTP port
6. Web content feature DNS mechanism during activation/authentication improved
7. Web interface can be authenticated through LDAP or user accounts configured from [System Maintenance] – [Admin Setting]
8. Admin Login through WAN can now be disabled
9. DHCP options (ASCII/Hex) can be set under [LAN] – [General Setup]
10. Added a VLAN failsafe option to the [LAN] – [VLAN] section
11. Added an “Always On” checkbox for IPv6 – AICCU tunnel
12. Add VoIP Inter-digit timeout for TR-104.
13. Added a telnet command to set which ADSL modulation types are used with the Modulation set to Multimode: % adsl automode [add|remove|set|default|show][adsl_mode]
14. Support WLAN IGMP snooping.

Improvement

1. Router's handling of AICCU neighbour packets.
2. Time and Date: Daylight Saving doesn't work with time zone Adelaide (GMT +9:30).
3. An issue with sending pings between VLAN subnets
4. 4G WiMAX / LTE web user interface settings could not be saved.
5. VPN: Windows 7 L2TP over IPsec client could not pass traffic immediately after connecting
6. Improved processing of multiple simultaneous PPTP dial in/out connections
7. VPN: If MPPE was enabled, the PPTP Dial-in user VPNs could not connect
8. VPN: IPSec LAN to LAN VPN tunnel could not pass PPTP VPN traffic
9. VPN: PPTP Dial-in user VPNs could not create a PPTP VPN through that tunnel
10. WLAN: Incorrect country code sent which affected Mac and Linux computers connecting wirelessly on channels 12 and 13
11. WLAN: Router was broadcasting SSID when wireless was disabled by schedule
12. The RADIUS request of WLAN clients was rejected by Synology NAS RADIUS server
13. Two IP phones behind NAT are unable to call each other after a period of time
14. SIP ALG: "via" information was not being modified correctly
15. App Enforcement: Now supports blocking RaidCall (v7.0), PPStream (v2.7.0.1512), and Teamviewer (v8.0.16284, v7.0.15723).

16. Load Balance Policy: can now specify a VPN tunnel to pass traffic through
17. Supports connecting to an LDAP Server via hostname.
18. SMS Alert: Added support for "messagebird.com" SMS Service.
19. H.323_alg passthrough support
20. [NAT] – [Open Ports]: can now specify All as a WAN option
21. Time and Date: Modified the NTP DNS resolution period from once every 20 seconds to 10 seconds prior to the time specified by Automatic Update Interval.
22. Corrected routing for WLAN SSID broadcast packets
23. SNMP: IP Routed subnet IP of router would not respond on SNMP
24. The router accepts asterisk (*) as the administrator password.
25. [LAN] – [LAN Port Mirror]: Restart no longer required after changing settings
26. Improved: Web Content Filtering: When the user accesses a website present in two categories with Commtouch, the router can only show/handle one category.

Known Issue

1. The SSL VPN function uses port 443. If NAT redirecting port 443 to an internal server please change the routers SSL VPN port via [SSL VPN]>[General Setup]
2. MoTP Dial-In User profiles cannot be saved via Web UI. A work around is to setup PPTP without MoTP and then use telnet to enable.

```

> vpn dinset ?
% vpn dinset
% vpn dinset <list index>
% vpn dinset <list index> <on/off>
% vpn dinset <list index> motp <on/off>
% vpn dinset <list index> pin_secret <pin> <secret>
> vpn dinset 1
Dial-in profile index 1
Profile Name: motep
Status: Active
Mobile OTP: Disabled
Password: 1234
Idle Timeout: 300 sec
> vpn dinset 1 motp on
% Enable Mobile OTP mode!
> vpn dinset 1 pin_secret 1234 123456789abd1234

```

Firmware Version	3.6.3 db
Release Date	31 st Dec 2012
Build Date	15th Oct 2012
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

New Features

1. IPv6 Support added
2. Support for Smart Bandwidth Limit added
3. SNMP v3 support added
4. Support for QoS DiffServ retagging added
5. Support ADSL PVC to PVC binding
6. VoIP Wizard added
7. Each LAN Subnet now supports setting an individual DNS setting
8. New SMS & Mail Service Object added
9. New load-balance policy function supports the routing requirements for IP routing subnets
10. User Management now supports Web Authentication using either HTTPS or HTTP

Improvement

1. Removed ADSL2/2+ Annex M from "multimode" auto-detect mechanism due to interoperability issues that could cause incorrect modulation to be set. For Annex M lines please manually set the modulation to Annex M instead of multimode.
2. Resolves an issue that could prevent correct Static route functionality when multi-subnet is enabled
3. Corrects a Routing table display error in [Diagnostic] > [Routing Table] menu
4. Corrects the LAN interface that is displayed for static ARP
5. Resolves an issue that could prevent two computers within the same VLAN from communicating with each other when connecting via different switches
6. Fixes an issue in IGMP snooping which would prevent two IPTV clients from watching the same channel
7. Corrects an issue that could cause Dynamic DNS to force update even though there was no WAN IP change
8. Corrected: Remove the incorrect log of PPP start (XXX), for we don't know who the incoming client is before authenticated by CHAP/PAP.
9. Addresses an issue that would prevent Android phone from obtaining FTP file list from Vigor 2830 FTP server
10. Corrects an issue where NAT port redirection for a WAN1 Alias IP doesn't work when port redirection setting doesn't specifically list the Alias
11. Addresses an issue with True IP DMZ
12. Resolves configuration issues that could occur in [WAN] > [General Setup]-
13. Wireless country string corrected
14. Addresses an issue that could occur with the wireless AP Discovery feature

15. Improved Wireless 802.1x compatibility with linux Radius Server
16. A user can send a FAX not only using T.38 protocol but also G.711.
17. Resolves an issue which would prevent IP Phones behind the Vigor 2830 from registering after a WAN failover because the router would send UDP packets with a source port of 0.
18. Fixes an issue with sending DHCP Relay via VPN tunnel
19. Addresses an issue with GRE IPsec tunnels
20. Resolves an issue that would prevent AES192 or AES 256 being used as the IKE proposal if AES without authentication is selected as the IPSec Security method
21. Corrected firewall so that is able to block internal router subnet packets
22. URL Content Filter Syslog improved so that it displays HTTP or HTTPS
23. Resolved an issue that would prevent external client from access internal RDP server via IP routing subnet
24. Fixed an issue that would prevent wireless clients successfully completely 802.1x authentication after router reboot
25. Incoming ICMP packets from WAN side can not ping "IP routing subnet" interface IP
26. Fixed an issue that could case CPE to loss connection when it connects to VigorACS server with STUN server.
27. Removed VoIP option in Multi-PCS setting for non VOIP models. Multi-PVCs setting page.
28. Improvements to WCF service stability
29. Clear button added to SIP account page
30. DHCP Server Lease time field added for each subnet.
31. Syslog improved to show which devices have been allocated IP by router
32. Added support to allow the router to send the TR-069 packet out via LAN interface
33. Support GRE over IPsec with CISCO. (4 bytes GRE header)
34. Modified the default pool size of LAN DHCP server from 50 to 150.
35. Correct error with Secondary DNS displayed in Online Status
36. Added new DDNS provider (UBDdns, Oray, and Peanut Shell).
37. Improve Samba compatibility with Mac OS X.
38. Bandwidth Limit range changed to 0 - 30000
39. Port Redirection can shows WAN Interface for each rule in the main page
40. For Safari based browsers the User Management redirection page method has been improved
41. Application Filter updated to support dropbox version 1.4.11 and skype version 5.10.56.116.
42. ADSL state information update frequency decreased from 5 to 30 seconds
43. "Undefined Protocol" DoS defense function renamed as "Unassigned Numbers"
44. Updated 3G modem support including MF190J, AnyDATA ADU-500A, LG VL600 LTE, and LTE Yota LU150
45. Improve the connection performance for Huawei E398/K5005 and Sierra 320U dongle.
46. QoS disabled by default for non-VoIP models.
47. QoS for VoIP enhanced
48. ALG for SoftPhone Polycom and lift-size improved
49. VPN Profile WUI improved
50. UCF/WCF block web page modified
51. SNMP's sysDescr can show model name and firmware version.

- 52. TR-069 support added for IP Route subnet parameters, firewall parameters, RADIUS parameters, WAN Connection Detection and SysLog / Mail Alert Setup parameters
- 53. 3G WAN connection Signal parameter status added to TR-069, Renamed TR-069 parameter "InternetGatewayDevice.X_00507F_Firewall.DoSDefense.BlockUnknownProto" to "InternetGatewayDevice.X_00507F_Firewall.DoSDefense.BlockUnassignedNum"
- 54. ip arp accept telnet command changed to give separate control over behaviour (pass or block) for both incorrect source mac and incorrect destination mac. 'ip arp accept <0/1/2/3/status>'
- 55. Added a telnet command to configure IGMP Query packet interval time. 'ip igmp_proxy query [msec]'
- 56. Added a telnet command to configure flash hook minimum and maximum time for VoIP.
- 57. Added a telnet command to allow VPN packets to instead go through by NAT if VPN disconnected 'vpn pass2nat <on/off>'

Known Issues

(None)

Firmware Version	3.3.7.1 db
Release Date	14th May 2012
Build Date	10th May 2012
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
ADSL Modem Code	232201
Locale	UK Only / Annex A Only

New Features

1. Support SMS (Short Message Service). When WAN backup mechanism is activated the system administrator can be notified via a SMS message to their mobile.
2. Support Common E-mail / Send Syslog via email.
3. Support External Devices Auto-detection mechanism.
4. Removed ADSL2/2+ Annex M from "multimode" auto-detect mechanism due to interoperability issues that could cause incorrect modulation to be set. For Annex M lines please manually set the modulation to Annex M instead of multimode.
5. Support Address Mapping for NAT configuration.
6. Support hardware MD5/SHA1 encryption.
7. Allow Mail Alert to send emails with VPN notifications.
8. Allow the router to be managed and controlled by SmartMonitor.
9. Support 56K AFM102 USB Modem.
10. Support to set DNS for each LAN subnet.
11. Support IP Routing subnet parameters to TR-069.
12. Support System Maintenance>> Login Customization.

Improvement

1. Improved: Add a new telnet command "voip sip misc -D" to disable/enable VoIP service.
2. Improved: Add a new telnet command "srv dhcp custom_option" which allows a user to enter user-defined "DHCP option".
3. Improved: Support disable/enable user mode on WUI. The factory default setting is disabled.
4. Improved: Improve the compatibility with VigorACS SI v1.08
5. Improved: SIP address format (either Withheld@.. or anonymous@..) can be blocked if Block Anonymous under VoIP>>DialPlan>>Call Barring is configured.
6. Improved: Incoming calls with SIP from header field without having an account name (e.g., tagged with 5E623524-172D) can be blocked if Block Anonymous under VoIP>>DialPlan>>Call Barring is configured.
7. Improved: Corrected some SNMP reporting for LAN status
8. Improved: Support Syslog Explorer with Web Syslog and USB Syslog under USB Application.
9. Application.
10. Corrected: DDNS does not upgrade automatically when the DDNS account is set for
11. WAN2 only.
12. Corrected: Data Flow Monitor does not show TX value for the monitored IP address and
13. RX value for WAN1 on PPTP Host-LAN environment.
14. Corrected: Cannot connect VPN via 3G (WAN3) when WAN1 or WAN2 is connected.

15. Corrected: RIP over VPN does not work.
16. Corrected: My WAN IP setting does not work for PPTP in VPN NAT mode.
17. Corrected: Cannot create LAN-to-LAN VPN connection via WAN3 when WAN1 or WAN2 is connected.
18. Corrected: My WAN IP setting does not work for PPTP in VPN NAT mode.
19. Corrected: A compatibility issue occurs when IPSec Aggressive mode is used and set with local IP address.
20. Corrected: User-Based mode of user management does not work if HTTPS management port has been changed.
21. Corrected: WAN cannot get IP from DHCP server when Block Fraggle Attack is checked in the page of Firewall>>DoS Defense.
22. Corrected: Ping detection failed when target IP and gateway are in the same subnet.
23. Corrected: When WAN 1 is disconnected, the router cannot send the SIP register packets of internal VoIP phones via WAN2 port automatically.
24. Corrected: VigorPhone350 loses registration behind NAT after one or two weeks
25. Corrected: NAT improvements to previous VoIP calls disconnecting after 2-3 minutes
26. Corrected: Wireless client cannot access LAN network from another AP that's connect to 2830 wireless LAN.
27. Corrected: Corrected syslog log display error showing http:// rather than https:// for keyword blocked visits to https sites.
28. Corrected: The minimum value is 48 seconds for the session-timer setting in "VoIP >> Phone Settings "
29. Corrected: Remove "Ultrasurf" from Web Content Filter WUI.

Firmware Version	3.3.6.1 db
Release Date	1st July 2011
Build Date	1 st June 2011
Applicable Models	Vigor2830, Vigor2830n-plus (Dual band), Vigor2830Vn-plus (Dual band)
ADSL Modem Code	232201 (Standard)
Locale	UK Only / Annex A Only

New Features

1. Support for Motive ACS Platform
2. Additional Notification functions in TR-069
3. PPP Assignments for LAN2/3/4 start at 200, like LAN1

Improvements

1. Corrected: Instability if WLAN MAC address access control was enabled
2. Corrected: DNS proxy now provided for DHCP clients by default
3. Corrected: telnet command: wol fromWan on/off - lets WOL packet pass from WAN to LAN.
4. Corrected: Incorrectly configured 802.1x clients could not connect to WLAN
5. Corrected: Modify the error correction telnet command for FAX relay.
6. Corrected: The APP Enforcement may not always work in user management.
7. Corrected: Release buffer failed when VPN is L2TP over IPSec and WAN setting is PPTP.
8. Corrected: Protocol error occurred in predefined QoS service (SMTP and NNTP).
9. Corrected: Modify "Apply to 2nd subnet" to "Apply to IP Routed Subnet" on Bandwidth Management >> Bandwidth Limit page.
10. Corrected: NTP may not work when using 3G modem connection
11. Corrected: If HTTPS management port has been changed, the redirection page not shown
12. Corrected: Session Version in SDP is not incremented in reINVITE.
13. Corrected: Web configurator login authentication was not available to all LAN subnet IPs.
14. Corrected: When outbound QoS is enabled, PPPoE packet may be queued and resulted in dial-up failure
15. Improved: NAT Session Full problem occurred in some case.
16. Improved: Add error recovery packets in T.38 redundancy mode.
17. Improved: Modify NTP client backup mechanism. Always retry user defined NTP server when backup server fails (for isolate network).
18. Improved: Remove IP address with x.x.x.0 and x.x.x.255 in DHCP table IP list and hidden conflict IP for LAN IP.
19. Improved: Show "Invalid IP Address!" for IP Ping when there is no available interface.
20. Improved: Remove Multi-PVC page in user mode.
21. Improved: Rename "Tag-based Bridge" tab from Multi PVC page to "Port-based Bridge"
22. Improved: On WLAN menu

Firmware Version	3.3.6 (First Firmware Release)
Release Date	28th January 2011
Build Date	15th November 2010
Applicable Models	Vigor2830, Vigor2830n, Vigor2830Vn
ADSL Modem Code	232201 (Standard)
Locale	UK Only / Annex A Only

First Firmware Release for this model

[END OF FILE]

