

Release Notes for DrayTek VigorAP 905 (UK/Ireland)

Firmware Version	5.0.7 (Formal Release)
Release Type	Important – Review release notes and upgrade if the changes affect your system stability, performance, or security
Release Date	12 th August 2025
Build Date	5 th September 2025
Web Version	r4242.7da93d6c
Core Version	r669
Applicable Models	VigorAP 906
Locale	UK Only

New Features

(None)

Improvements

1. Improvements to the WUI access that could be affected by long-term use of DHCP

Known Issues

(None)

Firmware File Types


The file name of the firmware controls which upgrade type is performed.

If the file name is unchanged (e.g. xxxx.**sfw**) then the upgrade will just upgrade the firmware, whereas renaming the firmware to a **.rst** extension will wipe all settings back to factory defaults when upgrading the firmware.

Upgrade Instructions

It is recommended that you take a configuration backup prior to upgrading the firmware. This can be done from the AP's system maintenance menu.

To upgrade firmware, select '*firmware upgrade*' from the AP's system maintenance menu and select the correct file. The access point will perform the upgrade and automatically reboot once this completes.

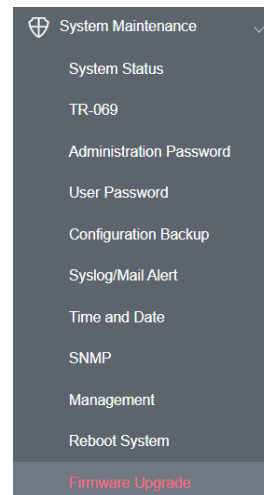

Manual Upgrade

If you cannot access the AP's menu, you can put the AP into 'TFTP' mode by holding the FACTORY RESET button whilst turning the unit on and then use the Firmware Utility. That will enable TFTP mode. TFTP mode is indicated by all LEDs flashing. This mode will also be automatically enabled by the router if there is a firmware/settings abnormality. Upgrading from the web interface is easier.

Firmware Version	5.0.6 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	8 th August 2025
Build Date	23 rd July 2025
Web Version	r4228.b62a3736
Core Version	r669
Applicable Models	VigorAP 906
Locale	UK Only

New Features

(None)

Improvements

1. Multiple SSID schedule profiles can now be used
2. The '4T4R' antenna option has been removed from [Configuration] > [Wireless LAN] > [Radio Settings]
3. Fix for the issue where AP could become unresponsive after firmware update
4. The gateway information via the Wireless App can now be properly shown
5. In some circumstance an issue could occur while attempting to ping the IP address of the VigorAP
6. Improvements to the management VLAN that could be set back to default when using config sync in AP management

Known Issues

(None)

Firmware Version	5.0.4 (Formal Release)
Release Type	Initial Release
Release Date	12 th June 2025
Build Date	12 th March 2025
Web Version	r4135.2862fb02
Core Version	r656
Applicable Models	VigorAP 906
Locale	UK Only

First Firmware Release for this model

[END OF FILE]