Release Notes for DrayTek VigorAP 1062c (UK/Ireland)

Firmware Version	5.0.5 (Formal Release)
Release Type	**Critical** – Upgrade recommended immediately
Release Date	14th April 2025
Build Date	24th April 2025
Web Version	r4135.2862fb02
Core Version	r656
Applicable Models	VigorAP 1062c
Locale	UK Only

New Features

(None)

Improvements

1. WLAN driver updates with security improvements (CVE-2025-20631, CVE-2025-20632 and CVE-2025-20633)
2. The 'Default VLAN' is added to [Configuration] > [LAN] > [VLAN List]
3. The [Configuration] > [LAN] > [Interface VLAN] section added for port VLAN configuration
4. The [System Maintenance] > [Management] > [XMPP] section added for XMPP protocol
5. SSH server security improvements (proxy-related functions has been disabled)

Known Issues

(None)

Firmware File Types

The file name of the firmware controls which upgrade type is performed.
If the file name is unchanged (e.g. *xxxx*.**sfw**) then the upgrade will just upgrade the firmware, whereas renaming the firmware to a **.rst** extension will wipe all settings back to factory defaults when upgrading the firmware.

Upgrade Instructions

It is recommended that you take a configuration backup prior to upgrading the firmware. This can be done from the AP's system maintenance menu.

To upgrade firmware, select *'Firmware'* from the AP's system maintenance menu and select the correct file. The access point will perform the upgrade and may automatically reboot once this completes.
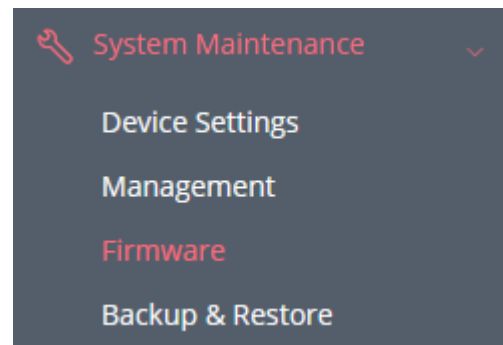
Manual Upgrade

If you cannot access the AP's menu, you can put the AP into 'TFTP' mode by holding the FACTORY RESET button whilst turning the unit on and then use the Firmware Utility. That will enable TFTP mode. TFTP mode is indicated by LED flashing. This mode will also be automatically enabled by the access point if there is a firmware/settings abnormality. Upgrading from the web interface is easier.

Firmware Version	5.0.3 (Formal Release)
Release Type	**Regular** – Upgrade recommended when convenient
Release Date	13th December 2024
Build Date	6th November 2024
Web Version	r3711.bd4a29bc
Core Version	r640
Applicable Models	VigorAP 1062c
Locale	UK Only

New Features

1. Support LLDP for Service Control

Improvements

1. Fixed MAC filtering profile name display error on [Monitor] > [Clients List]

Known Issues

(None)

Firmware Version	5.0.2 (Formal Release)
Release Type	**Regular** – Upgrade recommended when convenient
Release Date	3rd October 2024
Build Date	26th August 2024
Web Version	r3662.244b7698
Core Version	r638
Applicable Models	VigorAP 1062c
Locale	UK Only

New Features

(None)

Improvements

1. The reset button can be optionally enabled/disabled
2. Fix for the compatibility with VigorACS platform
3. The TR-069 username and password allowed characters note added:
   Username
   a-z,A-Z,0-9,@.-%
   Password
   a-z,A-Z,0-9,-%!$/()=?*

Known Issues

(None)

Firmware Version	5.0.1 (Formal Release)
Release Type	**Regular** – Upgrade recommended when convenient
Release Date	06th August 2024
Build Date	21st May 2024
Web Version	r3564.d02d6b04
Core Version	r606
Applicable Models	VigorAP 1062c
Locale	UK Only

New Features

1. Support for scheduled LED on/off and system reboot functionality

Improvements

1. Password mechanism changed to force admin to change the password from the default password
2. Improvements to the wireless performance with the SSID tag
3. The TR-069 username and password settings did to allow some special characters, such as '*' or '!'

Known Issues

(None)

Firmware Version	1.5.3 (Formal Release)
Release Type	**Initial Release**
Release Date	13th March 2024
Build Date	19th January 2024
Web Version	r3402.0eff8ccd
Core Version	r586
Applicable Models	VigorAP 1062c
Locale	UK Only

First Firmware Release for this model

Known Issues

(None)

[END OF FILE]